


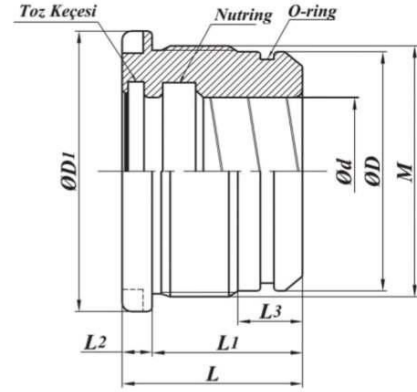

NO	ÜRÜN KODU	ØD	Ød	M	L2	L1	L3	L	ØD1	NUTRİNG (k33 PU)	TOZ KEÇESİ (K06 PU)	O-RİNG (70shr)
101	ÇMS-DK-90-65	91	65	M95x2	10	50	24	60	105	65x75x10	65x75x5/7	4x84
102	ÇMS-DK-90-70	91	70	M95x2	10	50	24	60	105	70x80x12	70x80x5/7	4x84
103	ÇMS-DK-100-30	101	30	M105x2	12	70	32	82	115	30x40x8	30x38x5/7	5x90
104	ÇMS-DK-100-32	101	32	M105x2	12	70	32	82	115	32x40x8	32x40x5/7	5x90
105	ÇMS-DK-100-35	101	35	M105x2	12	70	32	82	115	35x45x8	35x43x5/7	5x90
106	ÇMS-DK-100-38	101	38	M105x2	12	70	32	82	115	38x48x8	38x48x9	5x90
107	ÇMS-DK-100-40	101	40	M105x2	12	70	32	82	115	40x50x10	40x48x5/7	5x90
108	ÇMS-DK-100-45	101	45	M105x2	12	70	32	82	115	45x55x10	45x55x5/7	5x90
109	ÇMS-DK-100-50	101	50	M105x2	12	70	32	82	115	50x60x10	50x60x5/7	5x90
110	ÇMS-DK-100-55	101	55	M105x2	12	70	32	82	115	55x65x10	55x65x5/7	5x90
111	ÇMS-DK-100-56	101	56	M105x2	12	70	32	82	115	56x66x10	56x66x5/7	5x90
112	ÇMS-DK-100-60	101	60	M105x2	12	70	32	82	115	60x70x10	60x70x5/7	5x90
113	ÇMS-DK-100-65	101	65	M105x2	12	70	32	82	115	65x75x10	65x75x5/7	5x90
114	ÇMS-DK-100-70	101	70	M105x2	12	70	32	82	115	70x80x12	70x80x5/7	5x90
115	ÇMS-DK-100-75	101	75	M105x2	12	70	32	82	115	75x85x12	75x87x7/12	5x90
116	ÇMS-DK-100-80	101	80	M105x2	12	70	32	82	115	80x88x11,5	80x92x7/12	5x90
117	ÇMS-DK-110-50	111	50	M115x2	12	70	32	82	130	50x60x10	50x60x5/7	5x100
118	ÇMS-DK-110-55	111	55	M115x2	12	70	32	82	130	55x65x10	55x65x5/7	5x100
119	ÇMS-DK-110-60	111	60	M115x2	12	70	32	82	130	60x70x10	60x70x5/7	5x100
120	ÇMS-DK-110-65	111	65	M115x2	12	70	32	82	130	65x75x10	65x75x5/7	5x100
121	ÇMS-DK-110-70	111	70	M115x2	12	70	32	82	130	70x80x12	70x80x5/7	5x100
122	ÇMS-DK-110-75	111	75	M115x2	12	70	32	82	130	75x85x12	75x87x7/12	5x100
123	ÇMS-DK-110-80	111	80	M115x2	12	70	32	82	130	80x90x12	80x92x7/12	5x100
124	ÇMS-DK-115-50	111	50	M120x2	12	70	32	82	135	50x60x10	50x60x5/7	5x105
125	ÇMS-DK-115-55	111	55	M120x2	12	70	32	82	135	55x65x10	55x65x5/7	5x105